



August 21, 2009

SAFETY RECALL AND UPGRADE NOTIFICATION TO END-USERS OF RAILOK VERTICAL RAIL SAFETY SYSTEMS IMMEDIATE ACTION REQUIRED

Capital Safety Group Ltd (“Capital Safety”) is undertaking a voluntary safety recall of the trolley component of the DBI-SALA Railok Vertical Rail Safety System (“Railok System”). The Railok System is a fixed rail system comprising a trolley, rail, and attachment devices – see attached photograph of the Railok System and trolley component.

Since its introduction more than 30 years ago, the Railok System has complied with all applicable standards and passed all required performance tests, including EN 353-1:2002, the currently applicable standard. Further, the current Railok System is CE approved. Notwithstanding its compliance with applicable standards, Capital Safety is voluntarily recalling its Railok System trolleys and offering a free upgrade to a newly designed trolley that far exceeds the performance requirements of the 2002 standard.

The reason for the recall is the possibility that, under the latest set of tests designed to simulate a worker falling backwards, if a worker falls backwards before falling downwards (a scenario not contemplated by the dynamic test underlying the current standard), the trolley may not engage the rail as intended, and the worker may sustain serious injury. Earlier this year, the British Standards Institution recommended that new tests be included in an amendment to EN353-1:2002 that better represent all possible fall scenarios. Even though such new test procedures have not been incorporated into EN353-1:2002, Capital Safety has responded by developing an upgraded trolley as part of our continuing commitment to product improvements and state-of-the-art safety solutions. The upgraded trolley meets or exceeds proposed benchmark test requirements and thereby far exceeds the performance requirements of the current EN353-1:2002 standard.

If you have a Railok trolley in service, you should immediately take the trolley out of service and call our Customer Service department at +44(0) 1928 571 324 to arrange to return your trolley and be provided with an upgraded trolley at Capital Safety’s expense. The free upgrade applies only if the returned trolley is in proper working condition as determined by Capital Safety; if not, charges may apply.


Pending installation of the upgraded trolley, end-users must use alternative fall arrest systems (e.g., twin lanyard). This Notice relates to all Railok trolleys supplied by Capital Safety or its distributors at any time in the past.

Please direct any questions you may have to me as follows:

Steve Jervis BSc - Global Product Director, Systems & Anchors
t: +44 (0) 1928 571 324 ext 7206 | **f:** +44 (0) 1928 571 325
m:+44 (0) 7803 076 793 | **e:** sjervis@capitalsafety.com

August 21, 2009

DBI-SALA RAILOK VERTICAL RAIL SAFETY SYSTEM

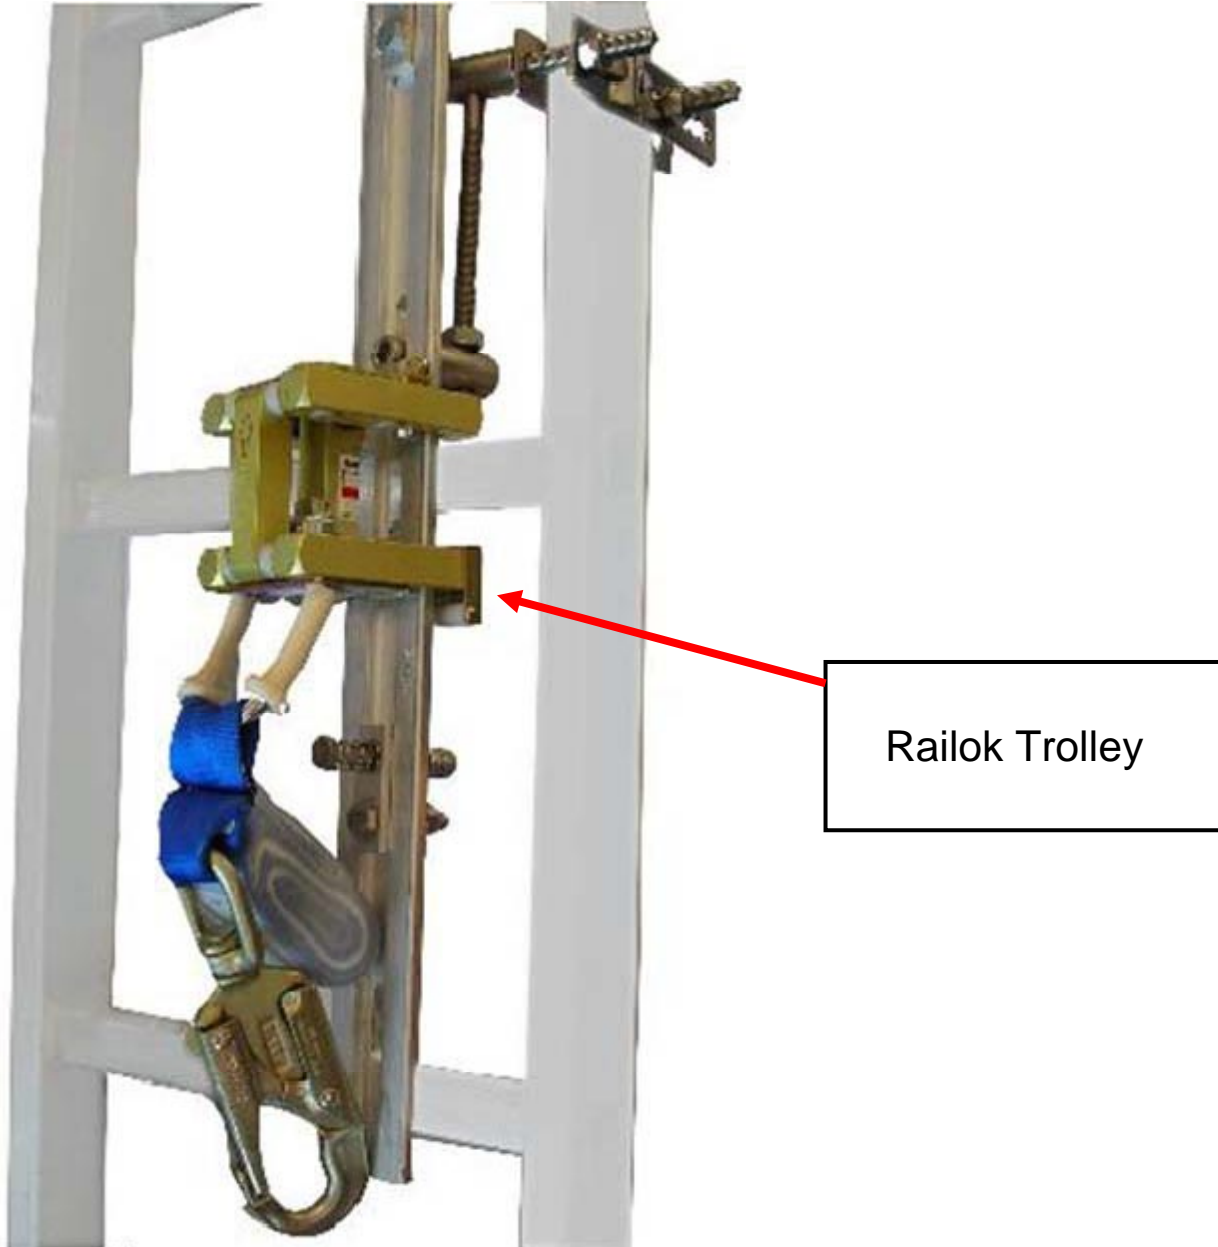

YOU ARE REMINDED THAT THE RAILOK SYSTEM IS CERTIFIED AS A COMPLETE SYSTEM, AND THAT USE OF INCOMPATIBLE COMPONENTS, OR COMPONENTS NOT SPECIFIED AND SUPPLIED BY CAPITAL SAFETY, WILL RENDER THE SYSTEM CERTIFICATION INVALID.
